

Mounting instruction

AIRCELL®5

FME-female, crimp/solder / item. No.:7808



Cut the cable end at right angles. Push the crimp sleeve over the cable end.




Remove with a knife 16mm of outer jacket.



Twist the copper braid at right angles.



Using a 6mm knife remove the copper foil.

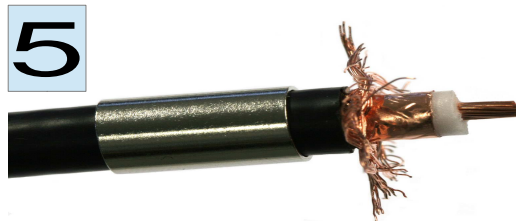

4mm of the foamed dielectric.



Place the inner pin on the conductor and solder.



Insert the end of the cable thus prepared into the socket housing as far as the stop (click). Cut the copper braid with a side cutter and push the crimp sleeve forward.



Crimp the crimp sleeve with a crimping plier; The copper mesh is clamped between the bushing housing and the crimping sleeve.